



Service Bulletin

Date: December 9, 2002

Product Line: Snowmobile

Bulletin No: 2003-1-22

Subject: VEV Drain Hose Location

Affected Models / VIN:

Model: 2003 Mountain Cat 900 (159 in.)

Model No. S2003MCVC9USB (Black - Orange 159)

VIN Range: 4UF03SNW73T313235 - 4UF03SNW23T313398

Condition: It has been determined that existing Variable Exhaust Valve (VEV) Drain Hose (p/n 0610-535) on the affected model may be positioned in the wrong location and may come into contact with the left side of the resonator. This condition may cause possible damage to the hose. See Fig. 1 for the incorrect location of the VEV drain hose.

Fig. 1



Fig. 2



Solution: Cut the existing cable tie securing the VEV drain hose to the coolant drain hose. Position the VEV drain hose near the resonator bracket support (snubber); then using a cable tie, secure the drain hose to the resonator bracket support (snubber). See Fig. 2 for the correct positioning of the hose and cable tie.

■ **NOTE:** Although it is not necessary to remove the expansion chamber for this procedure, removing the expansion chamber will allow you easier access to the VEV drain hose and resonator bracket support.

Parts: Not applicable (use appropriate length cable tie from your inventory to secure the VEV drain hose).

Warranty: A labor allowance of 0.2 hr will be paid per affected snowmobile.

Only one vehicle identification number (VIN) can be entered per claim. Do not submit a group claim.

CatTracker Claim: Enter BS200322 in the Complaint section.

Manual Claim: Enter 0322 in the Complaint section.

Enter 0 in the Quantity section.

