

---

---

## Models Affected/ Items of Concern

---

Prior to releasing 2005 ZR 900 or Firecat 500/700 models, please service the following items. See Service Bulletin 2005-1-06 for VIN Range and related information.

■ **NOTE:** Read these instructions thoroughly and carefully before beginning the following procedures.

---

---

### 2005 ZR 900 and Firecat 500/700 Models


---

#### Inspecting Torque Factors

##### Torque Bracket Cover

The three torx-head screws securing the torque bracket cover may not have been properly tightened and may come loose. Remove each screw (one at a time); then add **blue Loctite #243**, install the screw, and tighten to 33-37 in.-lb. Repeat for remaining screws. See Fig. 1.

Fig. 1

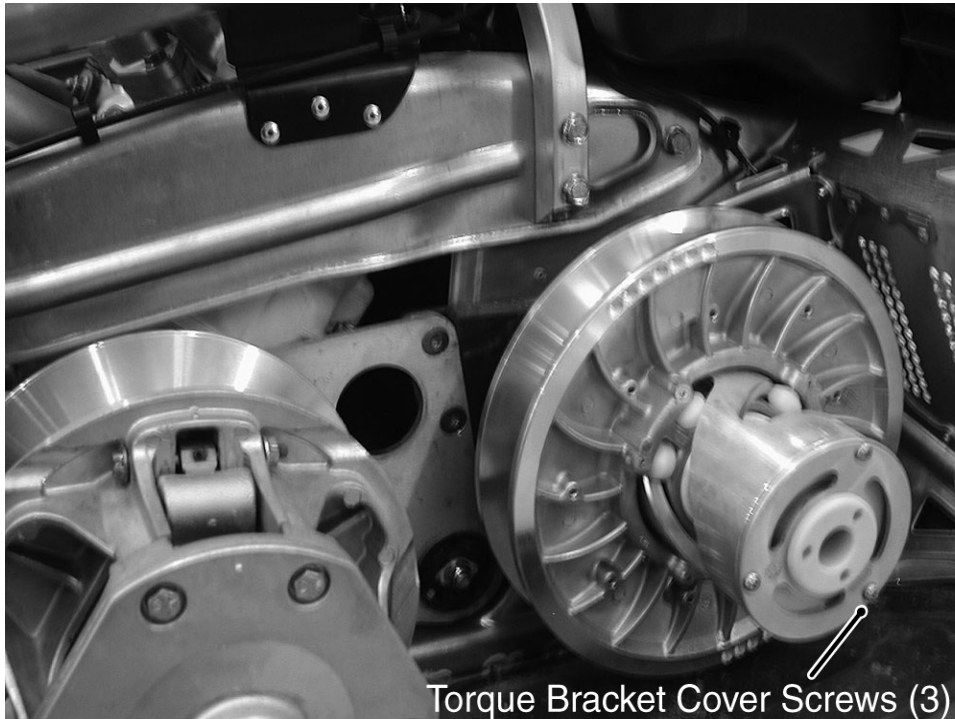

1653-004