



**Service
Bulletin**

**B0303011
2003-07**

Subject: Primary Drive Idler Arm & Pulley on the BAM Mower.

Affected Model/Serial Numbers:


968999214	BZ6134D	All S/N's up to 032600036
968999216	BZ7234D	All S/N's up to 032600070
968999218	BZ6127D	All S/N's up to 032600053

Service Information:

There is a possibility that the primary drive belt idler arm may be out of tolerance, allowing the idler pulley to misalign, causing the primary drive belts to prematurely wear or fray.

This can be checked visually, or it can be checked by using a straight edge. Lay the straight edge against the cast pulley on the spindle assembly above the idler. The belts must be centered in the idler pulley, and the idler pulley must in line with the cast spindle pulley.

If the idler pulley is not in alignment as described above, the idler arm is distorted and must be replaced.

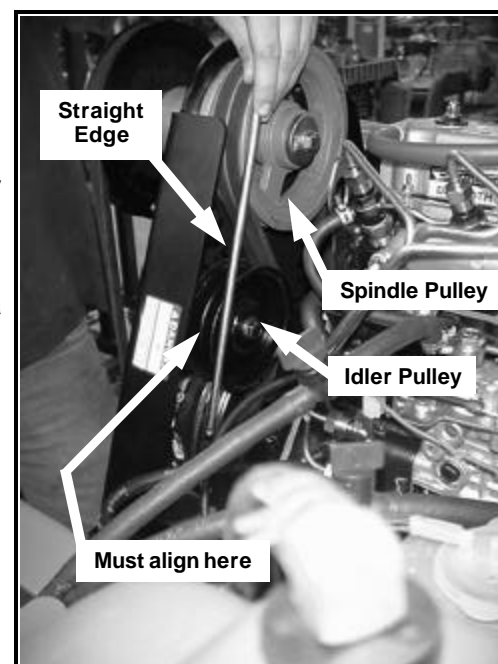

Engine Viewed from the Right Side

Parts Information:

The only component that should need to be replaced is the idler arm itself. All other components are transferable. Order part number . . . P/N 539 106422 . . . Idler Arm.

Warranty Information:

Normal warranty applies. One half (1/2) hour labor will be authorized to R & R the idler arm.