



Service Bulletin

B0303016
2003-8

Subject: Consumer Z Mower Deck Idler.

Service Information:

There is a round support washer under the bushing and large fixed idler on the CZ mower deck. The center hole in this washer is too large and could cause deformation in the deck and misalignment in the idler pulley.

The round support washer should be removed and discarded, and replaced with a rectangular pad with the correct hole size. One pad, shown below, is necessary to correct one CZ deck.

Parts Information:

P/N 539 103303 Qty. 1 Pad, Painted

Warranty Information:

Normal warranty applies.