



SERVICE	B0303023
BULLETIN	2003-10

Subject: Spindle Pulley for collection systems

Models Affected: All zero turn riding mowers manufactured after 9-15-2003

Service Information:

All new units manufactured since 9-15-2003 have a splined pulley on all spindles. The new drive kit is now manufactured with two pulleys (one of each) to work with either spline or keyed shafts. Old field inventory may need additional parts. When encountering this situation contact our service department. You will be asked to provide model and serial number and deck size along with a shipping address. We will send the parts from the factory. The chart below shows the different parts necessary.

Collection system changes			
Deck Size	Old Drive Kit	New drive kit	Parts required to update old kit
42"	539 106782	539 108960	539 108946 pulley 539 108950 shield 539 108951 bolt 539 976998 zerk 539 109906 Instructions
48"	539 106783	539 108961	539 108946 pulley 539 108953 shield 539 108951 bolt 539 976998 zerk 539 109906 Instructions
52"	539 106784	539 108962	539 108947 pulley 539 108958 shield 539 108951 bolt 539 976998 zerk 539 109906 Instructions
61"	539 106785	539 108963	539 108948 pulley 539 108959 shield 539 108951 bolt 539 976998 zerk 539 109906 Instructions