



SB, Trimmy S II – 343 R, 345 RX, Washer, 2004-06

When the Trimmy SII is fitted to the 343R and 345Rx a gap occurs between the driver on the bevel gear and the top of the trimmer head. This means that the trimmer head is not held securely enough and can slip. This causes heat to be generated, which melts the plastic in the trimmer head. The gap occurs because the output shaft is slightly too long and makes contact with the shoulder on the trimmer head where the thread starts. To prevent this happening a washer must be fitted between the trimmer head and the driver. This only applies when the Trimmy SII is fitted to the 343R and 345Rx.

The washer will be supplied with the Trimmy SII. For machines where the washer, part no. 537 29 96-02, is missing it must be ordered separately.

NOTE! The washer, part no. 537 29 96-01, must not be confused with the cup, part no. 537 29 24-01, that sits on the driver.

