



RIDER 1200-14

HOURLY METER

The leads which are connected to the hour meter maybe connected incorrectly. If the hour meter does not work, check that the red lead is connected to the plus marked(+) connection on the hour meter and the black lead to the minus (-) connection.

THROTTLE TRIGGER

The throttle trigger at the driver's seat is too easy to move on some machines due to too low friction between the attachment and the throttle trigger lever. This can lead to a change of position of the throttle trigger and reduction of the engine rpm. If this is the case, add an extra washer Ref. no. 735 11 73-55 and tighten the screw (725 23 74-71) until the throttle trigger moves heavily enough.

RIDER 850-970

SPARE PARTS NUMBER

The engine support has received wrong part number in the spare parts list. The old number 506 58 30-01 square D has by mistake not been changed. For the model 1991 of the Rider 850/970, the Ref. no. for the engine support should be 506 89 43-01.