



## KAWASAKI FC 150

The following information is important to even more improve the starting ability.

See the previous Service bulletin, tab 10 in the spanner binder, which covers the correct adjustment of throttle/choke cable.

1. Increase the play of the exhaust valve from 0.15 mm to 0.30 mm.
2. If the starting problem remain after the above mentioned checks, the ignition coil Ref. no. 531 00 12-06 and the ignition module Ref. no. 531 00 12-03 can be changed to 531 00 13-39. This provides a variable ignition advance. NOTE! Both the ignition coil and the ignition module must be changed in order to give this function.
3. The starter motor can also be changed on engines with electric start in order to receive a higher rpm. The starter motor has Ref. no. 531 00 13-38.