

Service Note N0203013 2002-05

Subject: HYDRAULIC SYSTEM REPAIR

Effected Model Numbers: All Husqvarna Turf Care Hydro Drive Mowers

Service Information:

As with all ZTH and WH hydraulic systems, anytime there is a <u>confirmed</u> hydraulic pump failure, the same side hydraulic motor MUST be removed, marked, disassembled, thoroughly cleaned, and resealed. Seal kits for the for the small "TE" motors have been merged to be used with either the 5 or 6 bolt motor.

Because the *Gen 2* large frame riders have a larger, "TF" Ross Hydraulic Motor, a special seal kit part number has been established.

Parts Information:

Gen 2 Units Only.

P/N 539106068 - Seal Kit, "TF" Hydraulic Motor

All Gen 1 Units and all Mini ZTH and WH Units.

P/N 539103664 - Seal Kit, "TE" Hydraulic Motor (includes 6 Grade 10 tie bolts)

Warranty Information:

Information only. Normal warranty policy applies.

N0203013 Page 1 of 1