



SERVICE
BULLETIN
131

INFORMATIONAL

ISSUED: November 11, 2005

SUBJECT: Carburetor Icing OH318EA Ariens Power Brush.

MODELS AFFECTED: OHM90 – 222304B,C. OH318EA – 222719D,E.

We have received field reports of carburetor icing on the OHM90 & OH318EA (Non-Snow King) engines equipped on Ariens power brush equipment. This occurrence has only been duplicated under conditions of high humidity and a temperature of below 40° F (4° C).

To alleviate this concern a new heater box has been designed, (**part number 730273**) which directs warmer air from under the muffler straight into the air cleaner intake snorkel when the air cleaner cover is in the winter position. The air cleaner cover position must still be changed for operation based on ambient temperatures. This new heater box only needs to be installed on units, which have exhibited this concern.

If a repair is necessary complete and file an electronic or OPEESA-157R warranty claim for 20 minutes.

