

SERVICE
BULLETIN
408
4 CYCLE



ISSUED: May 1999

SUBJECT: Hot Restarting of Swisher String Trimmer Mowers

MODELS OR TYPES AFFECTED: LEV115-350127D

We have been reviewing some field concerns regarding hot restarting difficulties on the above model and specification engines. This condition has been found to occur on some units after heavy use. The engine does not exhibit this condition when the unit is cold.

Before performing the repair outlined, check for fresh fuel, a good spark plug and the air filter condition. Then verify with the customer that they are **not** priming the engine for restarting which can cause a flooding condition.

Should you confirm the problem exists replace the carburetor with service part number **640142**, ordered from your normal source of supply. This recalibrated carburetor will correct the problem.

When you have re-assembled the engine, check for proper governed speed which is **3200 RPM + or - 150 RPM**.

When the repair is completed file for warranty using the ESA 157 claim form.