



# Service Bulletin

**Date:** December 9, 2002

**Product Line:** Snowmobile

**Bulletin No:** 2003-1-23

**Subject:** Coolant Drain Hose Location

**Affected Models / VIN:**

Model: 2003 Mountain Cat 900 (159 in.)

Model No. S2003MCVC9USB (Black - Orange 159)

VIN Range: 4UF03SNW73T313235 - 4UF03SNW73T313610


**Condition:** It has been determined that existing Coolant Drain Hose (p/n 0610-076) located at the front of the engine is incorrectly routed and may come into contact with the sharp edge of the chassis. This condition may cause possible damage to the hose. See Fig. 1 for incorrect routing of drain hose.

**Fig. 1**



Existing (Incorrect)  
Location of Drain Hose  
(Front of Coolant Hose)

**Fig. 2**

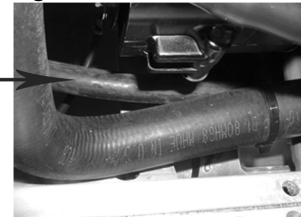

Correct Location  
of Drain Hose  
(Behind Coolant Hose)

**Solution:** Reroute the coolant drain hose behind the coolant tank-to-engine hose. See Fig. 2 for the correct routing of drain hose. Also, at this time, make sure the drain hose plug (white) is not located near the resonator. Using a cable tie, secure the drain plug away from the resonator.

**Parts:** Not applicable.

**Warranty:** A labor allowance of 0.2 hr will be paid per affected snowmobile. Only one vehicle identification number (VIN) can be entered per claim. Do not submit a group claim.

CatTracker Claim: Enter BS200323 in the Complaint section.

Manual Claim: Enter 0323 in the Complaint section.

Enter 0 in the Quantity section.



Printed in the U.S.A.



®™ Trademarks of Arctic Cat Inc., Thief River Falls, MN 56701



1202