



<b>Service Bulletin</b>	<b>B0108013</b>
	<b>2001-06</b>

**Subject: Retrofit Belt & Cable Kits**

**Model/Serial Numbers Affected:**

DT18C 968 98 10 01	BRIGGS 3.5HP	SERIAL NUMBER BEFORE	01240001
DT18C 968 98 10 02	HONDA 4 HP	SERIAL NUMBER BEFORE	01240001
DT18C 968 98 10 03	LESS ENGINE	SERIAL NUMBER BEFORE	01240001
DT18 968 98 10 06	LESS ENGINE	SERIAL NUMBER BEFORE	01240001
DT18 968 98 10 07	BRIGGS 5.5HP	SERIAL NUMBER BEFORE	01240001
DT18 968 98 10 08	HONDA 5.5HP	SERIAL NUMBER BEFORE	01240001
DT18 968 98 10 09	BRIGGS 8HP	SERIAL NUMBER BEFORE	01240001
SD18 968 98 10 10	BRIGGS 5.5HP	SERIAL NUMBER BEFORE	01240001
SD18 968 98 10 11	HONDA 5.5HP	SERIAL NUMBER BEFORE	01240001

**Service Information:** There is a possible issue with the belt not disengaging and possibly breaking on the units listed above. This situation can also cause premature belt wear. A retrofit kit is available to remedy the situation. The following kits will be used on the appropriate units.

There are instructions in each kit for proper assembly. The kits will contain all parts necessary to complete the installation including a different belt, cable and a new style of belt keeper, and associated hardware. **This will correct any problem associated with the drive belt.**

Two decals will also be included to put on their owner's manual and the machine to alert personnel to the changes that were made. Discard old parts after completion.

Time allowed is 1/2 hour per machine.

Model #	Model Code	Kit Part #
DT18C	968 98 10 01	540200563
	968 98 10 02	540200563
	968 98 10 03	540200563
DT18	968 98 10 06	540200578
	968 98 10 07	540200578
	968 98 10 08	540200578
DT18 8HP	968 98 10 09	540200603
SD18	968 98 10 10	540200578
	968 98 10 11	540200578
DT18 5.5HP With accessory bagger unit.	540 00 00 61	540200583
DT18 8 HP With accessory bagger unit.	540 00 00 61	540200604