

SB, Rider ProFlex 18, Rider Pro 18, Bolt, 2003-05

It has been discovered that, during week 10, the bolt that was fitted to activate the microswitch for the cutting deck is 10 mm too short.


The problem that arises is that the Rider cannot be started when the cutting deck is fitted to the machine.

The Riders that may be affected have a serial number between 031000411 and 031000570.

The fault can be rectified by replacing this bolt.

The correct bolt can be ordered direct from stock: part no. 725 25 44-51.

725 25 44-51

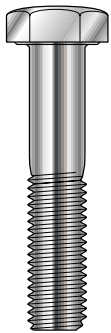

~~725 25 42-51~~

