



Service
Note

2000-06

N0001001

Page 1 of 1

Model(s) Affected: 322 / 325 Series Trimmers

Subject: Broken Throttle Cable Levers

We have found that in some cases, the travel of the trigger is greater than the travel of the carburetor throttle valve.

If the operator continues to squeeze the trigger, the excess force causes the trigger lever to break (Figure A).

Action Required:

If you experience this problem, please perform the following modification in addition to replacing the broken trigger lever.

Remove 1/8" from the outer housing of the throttle cable at the trigger end (Figure B). This will allow for greater travel of the lever and prevent future breakage.

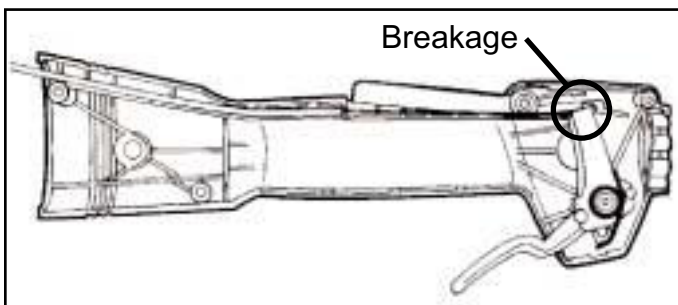


Figure A

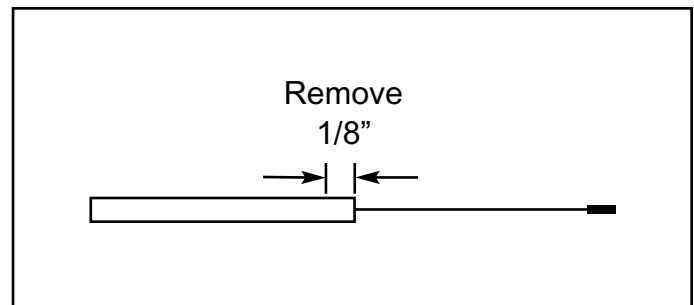


Figure B