


# **Husqvarna**

**S e r v i c e   N o t e**

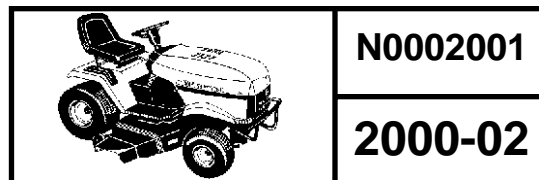


Engineering Services

Page 1 (2)


<b>MODELS</b>	<b>CTH 130</b>	954140100 A
<b>AFFECTED:</b>	<b>CTH 150</b>	954140101 A
	<b>LTH 130</b>	954140107 A
	<b>YTH 150</b>	954140108 A & B
	<b>YTH 180</b>	954140109 A, B, & C

Only units manufactured between 11-01-99 and 12-21-99 are affected.  
(Check first six digits of serial number to verify production date)

**SUBJECT:** Steering may not turn full right or left. Spindle arms may interfere with cast iron axle due to lack of washers.

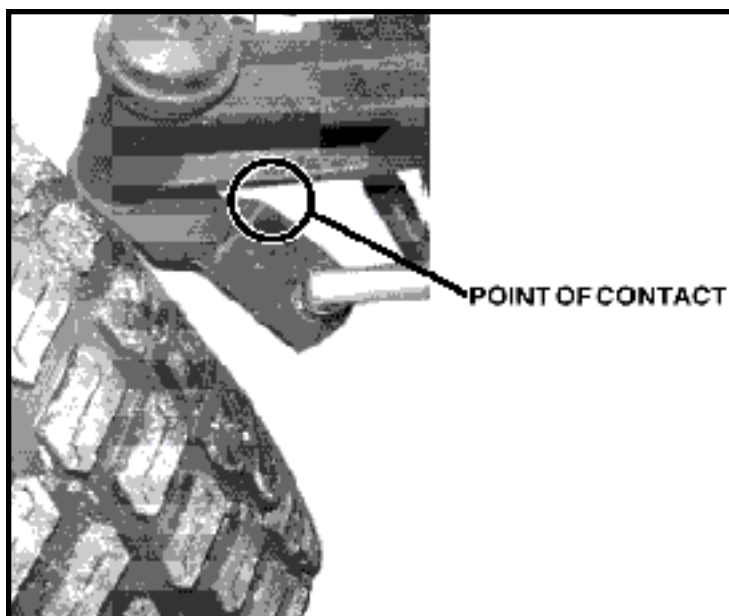

With the unit resting on a flat surface, turn the steering wheel for a full left and right hand turn. If either the left or right hand spindle arm interfere with the bottom of the axle, the unit must be reworked per the following instructions.

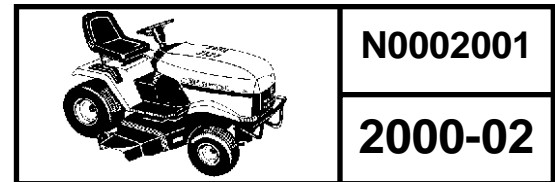

Engineering Services

Page 2 (2)

## ACTION REQUIRED:

After verifying that the unit needs to be reworked, please perform the following correction.

Remove the spindle assemblies, and add two washers (part # 532 12 17-49) to both sides. See diagram below.

