

## MODEL: LTH and YTH Riding Mowers with Cast Iron Axles

### SUBJECT: Excessive Front Axle Movement.

Some of the 1998 production mowers listed above had an oversized bushing install in the cast iron axle which increased the axle saddle width at each end. This can allow the axle to move back and forth. It can be corrected with the kit listed below. This will also work on any prior 1998 models listed above with the same symptoms.

#### Parts List

QTY. 1 Kit # 532 16 52-27 at no charge.

#### Installation Procedures

Complete RH bracket installation before starting LH side.

- 1) Remove and discard (2) bolts connecting rear axle brace on right side of chassis.
- 2) Install support bracket with (2) bolts and (2) nuts supplied as shown. Tighten securely.
- 3) Repeat procedure on left side of chassis.

