


For Husqvarna Parts Call 606-678-9623 or 606-561-4983

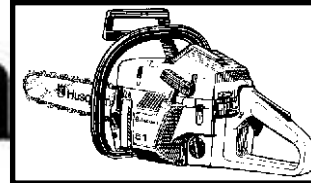

Product Service Bulletin



112498-15

1998-11

Engineering Services

Models Affected:

335XPT

Serial Numbers: Any affected unit.

Issue Reported: Intermittent slippage of starter at starter pawls when starting unit.

Action Required: Verify that all AV buffers (4) are in working condition and tightly secured. Order and install service kit, part # 531 03 05 85. The kit consists of a shouldered flywheel nut with a new starter rope. The rope uses a crimped sleeve in place of a knot to secure it in the starter pulley. Normal warranty labor will apply.