


For Husqvarna Parts Call 606-678-9623 or 606-561-4983

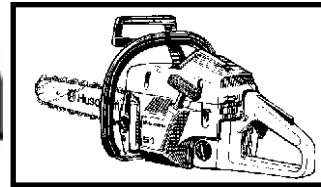

## Product Service Bulletin



030599-03

1999-03

Engineering Services

### **Models Affected:**

51, 55, 55 Rancher

### **Serial Numbers:** Various

**Issue Reported:** Some units have reported higher than normal 'starter kick-back' when cranking. This can also result in damage to the starter pulley and starter housing under some conditions. This condition would be found to be more prevalent on the Model 51 and 55 Rancher, as the Model 55 uses our 'Smart Start' decompression feature.

**Action Required:** Replace the ignition coil with a new ignition coil, part # 503 62 02 03. This new ignition coil has different cranking speed characteristics which will correct this situation. The original ignition coil, part # 503 90 12 01 will supersede to this new coil when ordered.