



Engineering Services

Page 1 (1)

MODEL: YT & GT Tractors With 46" Decks

SUBJECT: Premature primary deck belt failure,
particularly in low cut applications.

ACTION REQUIRED:

Verify proper deck leveling and insure that the deck gauge wheels are not touching the ground when in the cutting position. Raise the gauge wheels if necessary to obtain at least a 1/2" clearance between the ground and the bottom of the gauge wheels.

If the problem persists, order and install service kit part # 532 16 61-09. This kit contains a spacer washer, a new V-belt, and instructions on assembly.