



Service Advisory

TRACTORS

W-144

Models Affected: LT-542G, LT-542H, LT-942H, LT-946H, LT-946G, LT-950H, GT950H, GT-954H

Serial Number Range Affected: Tractors produced with Operator-Controlled Reverse (OCR) Ignition Switch Module

Date: **August 23, 2006**

Subject: **Resistor Spark Plugs**

IMPORTANT ATTENTION PARTS MANAGER ATTENTION SERVICE MANAGER

Always use resistor spark plugs when servicing tractors equipped with Operator-Controlled Reverse (OCR) ignition switch module. Using Non-Resistor spark plugs could cause the module not to activate. If the module is not activated, the tractor can not be operated in reverse with the blades (PTO) engaged. *Although the unit "fails safe", the REVERSE CAUTION MODE feature (ability to temporarily operate the tractor in reverse with the blades engaged) may not function.*

NOTE: *The Operator-Controlled Reverse (OCR) ignition switch module is part of the tractor's reverse operation safety system. This safety system must be in place and functioning as described in the operator's manual. Never disconnect it! Always check the Operator-Controlled Reverse (OCR) ignition switch module for proper operation before returning the tractor to the customer.*

This is being released for informational purposes only.

SERVICE MANAGER	PARTS MANAGER	SALES MANAGER	SERVICE TECH.	SERVICE TECH.

Circulate and Initial