

SB, Riders, Steering column, 2003-04

For a short period, steering columns have been produced with mounting holes that have too large a thread tolerance. See diagram no. 1.

This means that there is a risk that the threads on the mounting may be stripped if excessive torque is used when tightening the locking screws (728 74 55-05). See diagram no. 2.

If a thread is damaged it is recommended that an M8 Helicoil is fitted.



Diagram no. 1

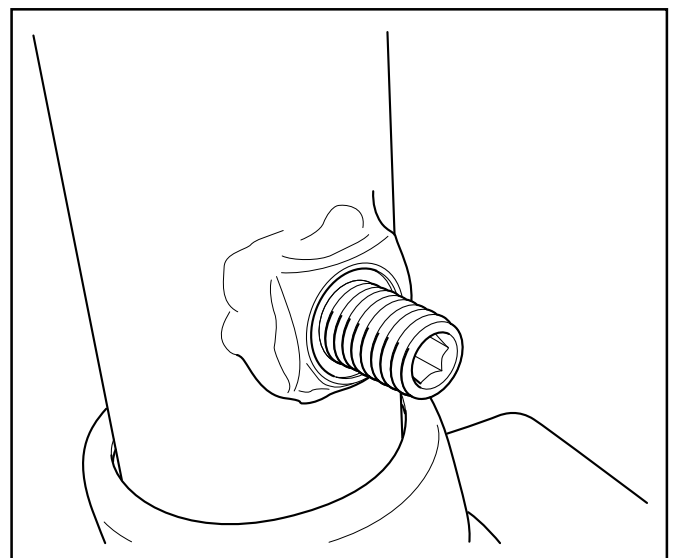


Diagram no. 2