



# Service Bulletin

**Date:** January 2, 2003

**Product Line:** Snowmobile

**Bulletin No:** 2003-1-29

**Subject:** Hood Vent Foam (PTO-Side)

**Affected Models / VIN:**

All 2003 Mountain Cat 570's

**Model No:** S2003MCDFCUSB

**VIN Ranges:** 4UF03SNW53T168275 - 4UF03SNW33T168761

4UF03SNW03T314808 - 4UF03SNW03T314971

**Condition:** Hood Vent Foam (p/n 0617-426) located on the PTO-side of the hood was designed to prevent snow from entering the clutch area. It has been determined, however, that the foam prevents the air from the engine fan to escape through the air-out duct. This condition may cause the air-out duct to overheat resulting in possible heat damage to the duct.

**Solution:** Remove Hood Vent Foam (p/n 0617-426). See Fig. 1 for the location of the foam to be removed. Please advise all owners of an affected snowmobile concerning this issue.

**Parts:** Not Applicable (No parts needed).


**Warranty:** A labor allowance of 0.2 hr will be paid per affected snowmobile. Only one vehicle identification number (VIN) can be entered per claim.

CatTracker Claim: Enter BS200329 in the Complaint section.

Manual Claim: Enter 0329 in the Complaint section.

Enter 0 in the Quantity section.

**Fig. 1**

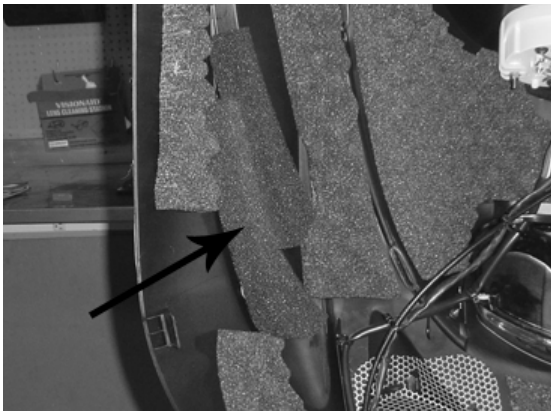

Printed in the U.S.A.



®™ Trademarks of Arctic Cat Inc., Thief River Falls, MN 56701



0103