


For Husqvarna Parts Call 606-678-9623 or 606-561-4983



Product Service Bulletin

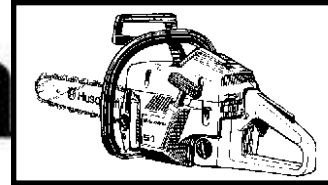

101498-12

1998 - 10

Engineering Services

Models Affected:

340, 345, 350

Serial Numbers: Prior to Serial # 8420951 - Model 340
8450001 - Model 345
8460001 - Model 350

Issue Reported: In some instances, the throttle trigger can “pop” out of the tank housing, most often when the operator’s foot is inserted into the rear handle opening for starting.

Action Required: Lightly snap the trigger back into the tank housing if it has come out. Locate the small dimple present at the throttle trigger position on both sides of the tank housing. Using a #34 drill bit, carefully drill into the tank housing at the dimple, approximately 3/8 inch in depth. Do this for both sides. Install steel dowel pin, part number 720 12 42 20 into the drilled hole, lightly tapping it with a hammer until it passes through the trigger into the opposite side of the tank housing. A #34 drill bit is available through Husqvarna, part # 531 03 05 74.