


For Husqvarna Parts Call 606-678-9623 or 606-561-4983



Product Service Bulletin

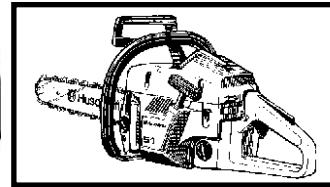

102998-13

1998-10

Engineering Services

Models Affected:

365, 371

Serial Numbers: Various

Issue Reported: Throttle trigger pin can fall/vibrate out. Replacement pin does not fit tightly in trigger pin hole.

Action Required: Order part # 531 03 05 80. This is an oversized dowel pin and will fit the trigger pin hole with an interference fit.