



**Service
Bulletin**

B0102001


2001-10

SAFETY RECALL

Subject: Tractor precautionary recall. A problem may exist with certain model tractors that may present a risk of fire due to a quality problem with 2 gallon front mounted fuel tanks.

Models Effected: Not all of these models are effected by the recall. The serial number range effected by this recall are tractors manufactured between November 7, 2000 and August 21, 2001.

Brand	MFG. ID NUMBER	SERIAL Date Range (MO/DA/YR)
Husqvarna	YTH1542(A)(B)(C) YTH1746(A)(B)	110700 Through 082101

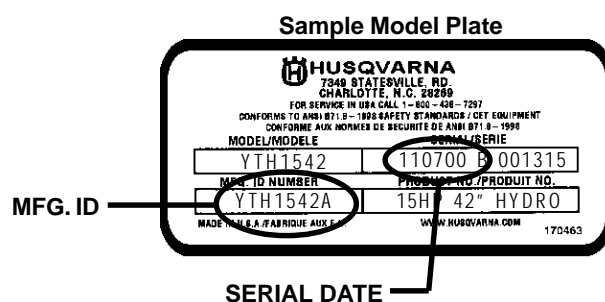

Condition: The 2 gallon fuel tanks on the recalled tractors have experienced quality problems where the fuel tank material has cracked at the fuel outlet and some tanks have begun to weep or leak gas.

Correction: Replace 2 gallon tank part # 532 17 46-42 with 1.25 gallon tank - Kit # 532 18 04-91. The current 2 gallon tank is no longer available.

Note: After rework has been performed, place an **X**, with a permanent marker, on top of the new fuel tank.

Parts: You will be sent an appropriate quantity of replacement tanks based on your tractor purchases.

Warranty: Return the special claim form to Husqvarna for reimbursement of \$27 for each tank replaced. Exact manufacturers I.D. no. & serial no. are required for each repair.

Should you have any questions regarding this precautionary recall, please call the toll free number 1-800-438-7297 Monday - Friday between 8:00 AM and 5:00 PM EST.